

SIEMENS

Guarto

Multifunctional

Security System

**Maintenance Info MI291a
MP3 - Service Release SR2**

Building Technologies

Fire Safety & Security Products

Liefermöglichkeiten und technische Änderungen vorbehalten.
Data and design subject to change without notice. / Supply subject to availability.
Sous réserve de modifications techniques et de la disponibilité.
© 2009 Copyright by
Siemens Switzerland Ltd

Wir behalten uns alle Rechte an diesem Dokument und an dem in ihm dargestellten Gegenstand vor. Der Empfänger anerkennt diese Rechte und wird dieses Dokument nicht ohne unsere vorgängige schriftliche Ermächtigung ganz oder teilweise Dritten zugänglich machen oder außerhalb des Zweckes verwenden, zu dem es ihm übergeben worden ist.

We reserve all rights in this document and in the subject thereof. By acceptance of the document the recipient acknowledges these rights and undertakes not to publish the document nor the subject thereof in full or in part, nor to make them available to any third party without our prior express written authorization, nor to use it for any purpose other than for which it was delivered to him.

Nous nous réservons tous les droits sur ce document, ainsi que sur l'objet y figurant. La partie recevant ce document reconnaît ces droits et elle s'engage à ne pas le rendre accessible à des tiers, même partiellement, sans notre autorisation écrite préalable et à ne pas l'employer à des fins autres que celles pour lesquelles il lui a été remis.

1 Maintenance Info MI291a: Guarto MP3 SR2

The first edition of MP3 for Guarto was released in January 2003. See related Up-data sheet UPe128. This release MP3 SR2 becomes available in January 2009.

MP3 is the common version for networked applications or standalone respectively. Mind the special version YCD01503 for the integration into the management station MM2000 with a relaxed check for the time synchronization via network.

This Service Release contains a new Real-Time-Clock driver with an auto-detect function for the current RTC chip and the new respectively. The new RTC chip replaces the current one which is not available anymore. Therefore, a new HW is provided with a socket for holding the new RTC chip device.

1.1 Actual Compatibility

Guarto MP3 SR2 Actual compatibility		Version	Memories	Remark/Checksum
Software Tool				
	Maintenance System SWE6	V5.0a		Release MP3 SR1
	Standard Text Editor SWU6	V4.4		Release MP3
Master Card E3X130				
	Control Unit Program	CCD005.03	Empty EPROM: Type 27C4001 = part. No. 476 362 0001	\$0AE2 /odd, \$0D1E /even Bridges EPROM: X11, Y12
	RAMs		RAM: 512kx8 = part no. 484 794	Bridges RAM: X10
LON Adapter K3I070				
		BKD002.02	Empty EPROM: Type 27C256 = part. No. 390 477	\$BC00
Terminal CT6M				
		V1.2		Index bb does not support Cyrillic
		V2.0		Index bc with new LCD-Controller for Cyrillic
Terminal CT6C				
	Firmware	CTD001.04	Empty EPROM: Type 27C512 = part. No. 417 745	\$B4D6
Door Module DCU601				
	Firmware	CFD003.03	Empty EPROM: Type 27C512 = part. No. 417 745	\$7BD6
	PAL	PFD002.00		\$457E
Dialer (IK601) K3D030				
	Firmware	CK6_V16	Empty EPROM: Type 27C512 = part. No. 417 745	\$DEC8

Tab. 1 Compatibility

1.2 Fixed Application Problems

The current RTC chip is not available anymore. So, a new pin compatible device with a new chip was produced in cooperation for Guarto and AlgoRex. This requires the use of a new RTC driver, which supports the current chip as well as the new device.

Therefore, a new HW version is provided too, where the current RTC chip is removed from the board and a socket is mounted instead, so that the piggy-back device with the new RTC chip can be inserted.

1.3 Fixed Tool Problems


For the mentioned SR1 of MP3 an improved SWE6 tool V5.0a was provided.

The following problems were fixed:

- The delay of remote transmission for 'Security-jeopardizing fault' and 'Major fault' was not visible and configurable anymore
(new range for each remote transmission type 10..1800s)
- Generation of CNAP profile adjusted that a data import of the management system doesn't stop anymore because of a section without zone
- Listing of configuration data (for sections) contained also the section number and not only the numbers of the linked zones

Installation (Update V5.0):

- Uninstall SWE6 MP3 V5.0
- Install SWE6 MP3 V5.0
 - When this message appears: click No

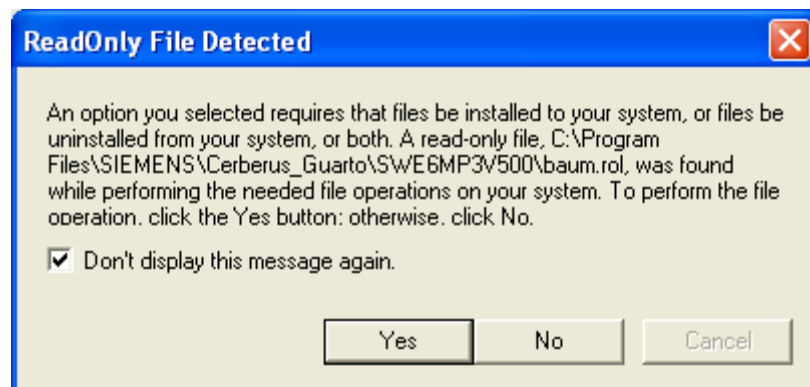

Siemens Switzerland Ltd
Building Technologies Group
International Headquarters
Fire Safety & Security Products
Gubelstrasse 22
CH-6301 Zug
Tel. +41 41 – 724 24 24
Fax +41 41 – 724 35 22
www.sbt.siemens.com

Document no. **A6V10235243**
Edition 01.2009

Manual CS6
Section 2